


Fujitsu *Gemini Lake* Mini-STX Mainboard

D3544-S

BIOS Release Document

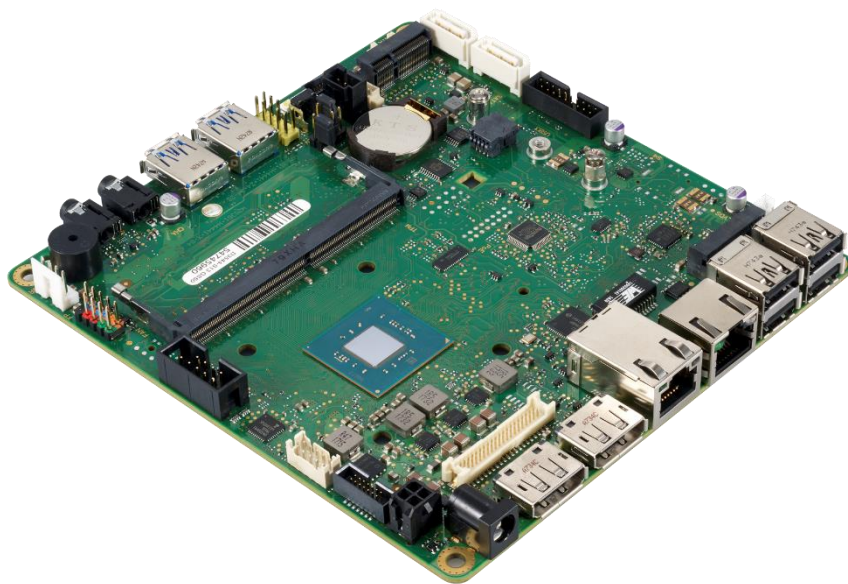

Content:

1	General Notes	4
1.1	Released OS Versions	4
1.2	BIOS Update Options	4
1.3	Modify BIOS Setup Settings and Defaults (Tool BIOSSET)	5
1.4	What's about DOS support and where are the DOS tools?	5
1.5	FTP BIOS Folder D3544-S	5
1.6	Note: Customer Service Release BIOS	5
2	BIOS R1.1.0	6
3	BIOS R1.2.0	7
4	BIOS R1.3.0 [new]	8

Revision History:

Date	BIOS Version	Notes
24.05.2018	R1.3.0	Added new BIOS version (R1.3.0)
17.04.2018	R1.2.0	Added new BIOS version (R1.2.0)
04.04.2018	R1.1.0	Updated "Known Issues"
27.03.2018	R1.1.0	Initial mass production release

1 General Notes

This BIOS is based on the AMI Aptio V5.0.0.13 R1.x.x

1.1 Released OS Versions

- MS Windows 10 (64bit)

1.2 BIOS Update Options

EFI Flash Update

Use ZIP-files for EFI-based BIOS Update

- Copy content of the BIOS ZIP to any FAT32 formatted USB drive/stick. The files should be visible in following directories:
 - EfiFlash.efi -> /EFI/FUJITSU
 - Flash update files (e.g. .UPD) in root directory of USB stick.
 - Boot the system and choose "FUJITSU Update Utility" in F12 boot menu.

Please see the EfiFlash for EFI (EfiFlashEfiUsage.txt) documentation for more information:

ftp://ftp.ts.fujitsu.com/pub/Mainboard-OEM-Sales/Services/Software&Tools/Common-Mainboard-Tools/EFI-Flash_Tool/

Windows Flash Update

Use *Dxxx-xyz.DFI.\$xe* for Windows-based BIOS update

→ Rename file to *.exe after download and run exe-file from MS Windows

Auto BIOS Update

With Auto BIOS Update it is possible to check a Fujitsu server automatically to see if there is a new BIOS version for the system. For the update, no operating system or external storage medium is required. This feature must be enabled in BIOS Setup first.

For details on the Auto BIOS Update function please see the BIOS manual.

BIOS Recovery

Please see the EfiFlash documentation for more information:

ftp://ftp.ts.fujitsu.com/pub/Mainboard-OEM-Sales/Services/Software&Tools/Common-Mainboard-Tools/EFI-Flash_Tool/

Additional information

If you have any problems after a BIOS flash please try if "Load Optimized Default Values" (F3) in BIOS setup solves the problem.

1.3 Modify BIOS Setup Settings and Defaults (Tool BIOSSET)

BIOS settings can be modified by the Windows and Linux tool BIOSSET (Modify BIOS Setup Settings and Defaults). See BIOSSET tool help (parameter -h) for further details.

<ftp://ftp.ts.fujitsu.com/pub/Mainboard-OEM-Sales/Services/Software&Tools/Common-Mainboard-Tools/Deskflash/>

Windows BIOSSET is part of the package [DeskView_x64_Instant_BIOS_Management_Vx.yy.zzzz.zip](#)

Linux BIOSSET is part of the package [DeskView_BIOS_Management_for_Linux_V1.xx.yyyy.x86_64.zip](#)

1.4 What's about DOS support and where are the DOS tools?

Due to Intel's and Microsoft's decision, there is no "Legacy" OS support (CSM mode) implemented anymore. So only usage of UEFI operating systems is possible. We will provide the necessary tools and documentation(*) for Windows and Linux.

Editcmos (DOS) -> Biosset (Windows and Linux)

EfiFlash.exe (DOS) -> Eflash.efi (EFI environment) or Dskflash/Deskflash (Windows/Linux)

SMCO, LVDS tool, OEMIdent are also available for Windows and Linux.

(*) not all documentation and tools are available yet. They will be uploaded on our FTP server as soon as possible.

1.5 FTP BIOS Folder D3544-S

The released BIOS versions are available here:

ftp://ftp.ts.fujitsu.com/pub/Mainboard-OEM-Sales/Products/Mainboards/Industrial&ExtendedLifetime/D3544-S_Mini-STX/BIOS_D3544-S/

1.6 Note: Customer Service Release BIOS

Besides the released BIOS versions there may be additional BIOS versions (Customer Service Release BIOS = CSR BIOS) that solve specific customer problems.

Please note: These versions are available via OEM FTP only and they are not pre-installed ex factory.

2 BIOS R1.1.0

First released mass production BIOS

Known Issues and Limitations: **[Updated]**

- No legacy OS support (UEFI only due to Intel restrictions)!
- BIOS Recovery flash not working as expected: BIOS Recovery flash process is running in endless loop until Recovery jumper is removed.
- RS422/485 mode selection for first COM port not yet supported.
- Second COM port not yet supported.
- Due to a BIOS bug, mainboard D3544-Sx is not yet EuP compliant (< 0.5W in "Off" mode).
 - Issue will be solved with upcoming BIOS R1.2.0

3 BIOS R1.2.0

BIOS Changes vs. R1.1.0:

- Feature: Serial port mode selection (RS-232, RS-422, RS-485) [only RS-232 is working!]
- Fixed: Power consumption in power off mode reduced.
- Fixed: Boot logo flash was not working.
- Fixed: WOL from ACPI S3 was working although disabled in LAN driver.
- Fixed: Setup string for "Package C State limit" corrected.
- Fixed: Setup string for "Secure Boot Mode" corrected.

Known Issues and Limitations:

- No legacy OS support (UEFI only due to Intel restrictions)!
- BIOS Recovery flash not working as expected: BIOS Recovery flash process is running in endless loop until Recovery jumper is removed.
- RS422/485 mode selection for first COM port not yet supported.
- Second COM port not yet supported.


4 BIOS R1.3.0 [new]

BIOS Changes vs. R1.2.0:

- Fixed: Corrected serial port mode selection (RS-232, RS-485, RS-422). RS422 and RS485 mode were interchanged. Super IO configuration was missing.
- Fixed: FTS Subsystem Vendor ID was not programmed to Intel graphic device.
- Fixed: eDP Brightness control in BIOS Setup did not work.
- Fixed: It was not possible to unlock a HDD via master password.
- Fixed: Clicking with the mouse while transitioning to S3 caused freeze of the system.
- Fixed: Wake on USB Keyboard from S5 was working, although disabled in BIOS.
- Fixed: System could be powered off by pressing power button during BIOS flash update.
- Fixed: Customized Setup default settings (Bioset.exe) were lost after a BIOS flash update.
- Fixed: USB security settings could lead to user lockout.
- Feature: Show LVDS dual channel configuration item in BIOS setup.
- Updated System monitoring characteristics

Known Issues and Limitations:

- No legacy OS support (UEFI only due to Intel restrictions)!
- BIOS Recovery flash not working as expected: BIOS Recovery flash process is running in endless loop until Recovery jumper is removed.
- Second COM port not yet supported.

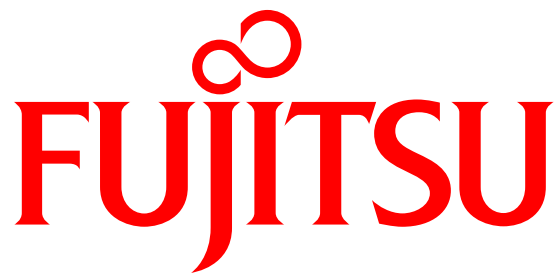

shaping tomorrow with you